

Cooney, Joanne

From: Mills, Katrice
Sent: Tuesday, 5 May 2020 4:27 PM
To: Grosvenor Mine Record
Subject: FW: Completed Mining incident report No. 144716 (30 - High potential no lost time [nmsf: 35])

Categories: Red Category

Please attach to 20200407-HPI-CH4 Exceedance LW104 TG 2.21PM 07APR20

W:\HSE\HSE\Grosvenor SHMS\SHMS\Std 3_Legal_Other_Req\Mine Record 2020\03 - Accidents HPIs & Investigations\20200407-HPI-CH4 Exceedance LW104 TG 2.21PM 07APR20

Thanks

Katrice Mills

Safety and Health Coordinator



E [Katrice.Mills](mailto:Katrice.Mills@angloamerican.com)

T +
M

COAL

GROSVENOR MINE

464 Goonyella Road, Moranbah, QLD 4744

www.angloamerican.com

A member of the Anglo American plc group

If this email is designated Highly Restricted or Confidential, then this information is confidential and therefore cannot be shared with other parties or used for purposes other than those for which it was intended.

From: MIRAdministration@dnrme.qld.gov.au <MIRAdministration@dnrme.qld.gov.au>
Sent: Tuesday, 5 May 2020 4:26 PM
To: MIRAdministration@dnrme.qld.gov.au; mirmackay@dnrm.qld.gov.au; Mills, Katrice <Katrice.Mills@angloamerican.com>
Subject: Completed Mining incident report No. 144716 (30 - High potential no lost time [nmsf: 35])

This message originated outside Anglo American

Type of incident

Incident report number: 144716

Recipients: Katrice.mills@angloamerican.com and MIRAdministration@dnrme.qld.gov.au

1 **Incident type:** 30 - High potential no lost time [nmsf: 35]

2 **Summary/title of incident**

Methane in Excess of 2.5% 07/04/2020 2.21pm

Incident Classification:

Code: 114 - Presence of gas [nmsf: 3827]

Breakdown:

Code: Other and unspecified agencies [nmsf: 2844]

Sub-Breakdown: Code: Other and not specified agencies [nmsf: 2890]

Breakdown Class: Code: Other agencies, not elsewhere classified [nmsf: 3188]

Detailed Classification: Code: Other agencies, not elsewhere classified [nmsf: 3766]

Compensation ID: 999999

Mechanism: Code: Heat, electricity and other environmental factors [nmsf: 2789]

Sub-Mechanism: Code: Exposure to other and unspecified environmental factors [nmsf: 2821]

3 **Previously notified:** Yes

Date: 07/04/2020

Mine details

4 **Mine/quarry name** Grosvenor Coal Mine **Code:** M02976 **Old Code:**

5 **Mine type:** coalUnderground

6 **Company contact:** Wouter Niehaus

Phone: [REDACTED]

7 **Where in the mine did the incident occur?** LW104 TG return roadway 3-4ct B hdg **Code:** 503 - Coal face-2nd workings [nmsf: 27]

Surface or underground? underground

Incident details

8 **Date of incident:** 07/04/2020

9 **Time of incident:** 14 21 (24 hr clock)

10 **Time shift started:** 06 00

Shift duration: 12 00

No. of complete shifts/day worked prior to accident: 1

No. of days in shift cycle: 14

No. of days rostered off prior to starting current shift cycle: 7

Total hrs worked in 24 hr period prior to accident, inc travel time: 12

Travel Time: 00 15

Rostered Travel Time: 00 30

Roster Pattern: 7/7

11 **Date of first full working day lost:**

12 **Primary equipment/tool involved in incident:** Longwall 104 **Code:** 119 - Longwall-other equipment [nmsf: 3884]

13 **Describe exactly how did the incident occur:**

At 2:21pm the Shearer was cutting from MG towards TG and was stopped at 115 shield for approximately 20 minutes when a gas exceedance occurred at the TG104 3-4ct B Hdg Outbye return monitor. This was due to additional methane make in the inbye C Hdg roadway and the chainage 3960m CH4 sensor recording 2.04% when the shearer stopped at 115 shield as per preset trips when CH4 is greater than 1.8%. The exceedance time above 2.5% was approximately 6 minutes with a maximum value of 2.52%.

14 **What hazards have been identified from this incident:**

Methane in general body atmosphere exceeding legislated limits

Code: 124 - Noxious liquids/gases

Injured person details

15-21 Questions 15 through 22 not required for 'High potential no lost time' incidents

23 Description of personal damage:

Is this a permanent incapacity? No

Incident causes

24 What happened leading up to the injury/incident/disease?

Organisational

Less than adequate methane pre-drainage / recovery / dilution.

Codes 102 - Design

Task/environment conditions

Gate stopped shearer at #115 however the CH4 was 2.12% and 2.24%.

Codes 320 - Task/environment factor (not specified)

Individual/team actions

Nil individual factors identified

Codes 222 - No ind./team factor involved

Absent or failed defences

Less than adequate Ventilation Control Devices to prevent goaf gasses entering C Hdg.

Codes 401 - Design defects

Preventative action

25 Give details of any control measures/actions being considered and/or implemented to prevent recurrences

Additional Shearer gate to be installed at Shield#90 Upgrade and install in front of LW the VCDs in the TG (ensure the permits and vent changes are updated)

Date: 05/05/2020

Your full name: Katrice Mills

Position: Safety and Health Coordinator

Email: Katrice.mills

Office use

□□□ □□□ □□□ □□□

Inspector/inspection officer: _____

Signed: _____

Entered by: _____

User IP address: 172.18.4.56

User agent: Mozilla/5.0 (Windows NT 10.0; Win64; x64) AppleWebKit/537.36 (KHTML, like Gecko) Chrome/64.0.3282.140 Safari/537.36 Edge/18.17763

Email address: [Katrice.mills](#) [REDACTED]

Submitted Date/Time: 05/05/2020 16:19:10

The information in this email together with any attachments is intended only for the person or entity to which it is addressed and may contain confidential and/or privileged material. There is no waiver of any confidentiality/privilege by your inadvertent receipt of this material.

Any form of review, disclosure, modification, distribution and/or publication of this email message is prohibited, unless as a necessary part of Departmental business.

If you have received this message in error, you are asked to inform the sender as quickly as possible and delete this message and any copies of this message from your computer and/or your computer system network.
